


# **Principles of Crimping Technology**

**Compendium**  
(unabridged version)

**CRIMP ACADEMY**  
[www.crimp-academy.com](http://www.crimp-academy.com)

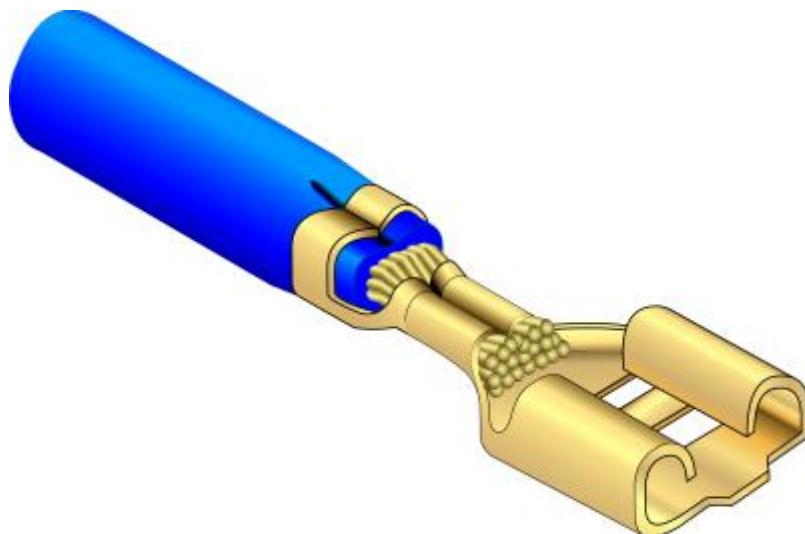

# Content

<b>1. Preface .....</b>	<b>25</b>
1.1    Important Notes on this Documentation.....	26
1.2    Partners and Sources.....	27
<b>2. Introduction: Technologies of Wire Processing Technologies .....</b>	<b>28</b>
2.1    A Fact .....	28
2.2    Crimping – A Joining Method.....	29
2.3    Standards, Factory Standards and Specifications for Crimp Connections .....	29
2.4    Processing of Stranded Copper Conductors.....	31
2.5    Development of Crimp Connections .....	32
2.6    Contact Resistance – The Underestimated Quality Criterion.....	33
2.7    Correct Assignment between Crimp Contact and Nominal Cross Section .....	34
2.8    The Objective of Wire Harness Making.....	35
2.9    The Objective of Crimping Technology .....	36
2.10    Reproducible Quality: Equipment .....	37
2.11    The Transition Zone – Where Flexible turns into Solid .....	38
2.12    The Effect of Mechanical Loads .....	39
2.13    Comparison of the Transition in Different Types of Connections .....	40
2.13.1    Overview .....	40
2.13.2    Soldered Connections.....	41
2.13.2.1    Tinned Conductors in Screw Terminals.....	41
2.13.2.2    Soldering and Connector Housings.....	42
2.13.2.3    Direct Soldering with Components .....	42
2.13.2.4    Soldering after Crimping .....	43
2.13.2.5    Soldering of the Conductor Crimp Area Before Crimping.....	43
2.13.3    Screw Terminals.....	44
2.13.3.1    Wire Ferrules and Screw Terminals .....	44
2.13.3.2    Insulated Cable Lug.....	45
2.13.4    Closed Crimp Barrel (4-Indent Crimp) .....	46
2.13.5    Open Crimp Barrel.....	46
2.14    Relieving the Transition Zone .....	47
2.15    Crimp Contacts, Cable Lugs and other Pressed Connectors.....	48
2.15.1    Open and Closed Barrel Crimp Contacts.....	48
2.15.2    The Open crimp Barrel.....	48
2.15.3    The Closed Crimp Barrel.....	49
2.16    Overview of Crimp Shapes.....	50
2.16.1    Open Crimp Sleeves.....	50
2.16.2    Closed Crimp Barrels.....	51
<b>3. The Conductor .....</b>	<b>53</b>
3.1    Basic Conductor Structure.....	53

3.2	Classification of Conductors .....	54
3.3	Notes on the Processing of Conductor Materials .....	54
3.4	Geometric Cross-Section vs. Nominal Cross-Section .....	55
3.5	The Conductor Insulation .....	58
3.6	Cables with Reduced Insulation .....	59
3.7	Copper Calculation.....	60
3.8	American Wire Gauge [AWG] and Metric Wire Standards.....	61
3.9	Cable Storage, Preparation and Feeding.....	62
3.9.1	Storage.....	62
3.9.2	Damage to the Insulation .....	63
3.9.3	Tension-free (Pre-)Feeding.....	64
3.9.4	Wire Storage Systems .....	65
3.9.5	Wire Pull Machine with Wire-Sag Control .....	67
3.9.6	The Wire Straightening Line.....	68
3.9.7	Routing or Guiding of Cables .....	69
3.9.8	Pre-Feeding.....	69
3.9.9	Roll Drive.....	71
3.9.10	Belt Drive.....	71
3.10	Gripping of Wires .....	72
3.10.1	General .....	72
3.10.2	Design of the Gripping Surface .....	72
3.10.3	Gripper Types.....	73
3.10.4	Flat Grippers.....	73
3.10.5	Prism Shaped Grippers.....	73
3.10.6	Form Grippers .....	74
3.11	Cutting Cables or Wires .....	75
3.11.1	General .....	75
3.11.2	Blades With Straight Cutting Edges .....	76
3.11.3	V-Shaped Blades.....	76
3.11.4	Cable Shears.....	77
3.11.5	A direct comparison: Cable Shears vs. Side Cutter .....	78
3.12	Wire Stripping .....	79
3.12.1	Basic Rules of Wire Stripping.....	79
3.12.2	Stripping Tasks.....	82
3.12.3	Partial Removal of the Insulation Jacket.....	83
3.12.4	Types of Stripping Blades .....	83
3.12.5	Straight Stripping Blades .....	84
3.12.6	V-Shaped blades for Cutting & Stripping .....	85
3.12.7	Radius blades for Cutting & Stripping.....	86
3.12.8	Radius Stripping Blades.....	86
3.12.9	Special Blades – Blade Combinations in Fully Automatic Machines.....	87

3.12.10 Rotative Stripping .....	88
3.12.11 Rotative Step Stripping (Koax) .....	89
3.12.12 Behavior of the Insulation during the Stripping Process.....	90
3.12.12.1 Positioning of the Blade Edge in relation to the Pulling Direction .....	90
3.12.12.2 The Contact Pressure of the Grippers.....	91
3.12.12.3 The Contact Pressure of the Feed Rollers.....	92
3.12.12.4 About the Quality of the Cutting Edges (Sharpness of the Blades) .....	95
3.12.13 Cutting & Stripping – Systems.....	96
3.12.13.1 Custom Programmable Stripping on Automatic Machines .....	96
3.12.13.2 Stripping & Twisting.....	100
3.12.13.3 The Blade Unit.....	101
3.12.13.4 The Blade Unit (Komax).....	104
3.12.13.5 Sequence of Operations in the Blade Unit.....	104
3.12.14 Error Descriptions during Stripping.....	108
3.12.14.1 Overview .....	108
3.12.14.2 Single Strands Damaged and / or Cut off .....	109
3.12.14.3 Single Wire Strand Pulled .....	110
3.12.14.4 Damaged Surface of the Wire Strands – Stripper-Crimper .....	111
3.12.14.5 Insulation Improperly Cut .....	112
3.12.14.6 Insulation Threads on the Cutting Edges.....	113
3.12.14.7 Insulation Damaged.....	114
3.12.14.8 Insulation Residue on the Conductor .....	115
3.12.14.9 Undone Twisting of the Wire Strands .....	116
3.12.14.10 Broom-shaped Conductor Ends .....	116
3.12.14.11 Kinked Wire Strand .....	116
3.12.14.12 Overtwisted Conductor.....	117
3.12.14.13 Variations in Stripping Length.....	118
3.12.14.14 Heavy Oxidation on the Conductor.....	118
3.13 Multi-Core Sheathed Cables.....	119
3.13.1 General .....	119
3.13.2 The Structure of Multi-Core Sheathed Cables .....	119
3.13.3 Cutting of Sheathed Cables .....	120
3.13.4 Blade Types for Sheathed Cables .....	120
3.13.4.1 V-Shaped Blades.....	120
3.13.4.2 Radius Blades .....	120
3.13.4.3 Special Blades.....	121
3.13.5 Processing of the Inner Conductors .....	121
3.13.6 Sizing of the Stripping .....	122
3.13.7 Stripping the Outer Sheath (Jacketing) – Schematic Representation.....	123
3.13.8 Rotative Stripping .....	124
3.13.9 Error Descriptions .....	125

3.13.9.1	Inaccurately Cut Sheath.....	125
3.13.9.2	Deformed Cable End– Deformed Inner Conductor .....	125
3.13.9.3	Damaged Inner Conductor.....	125
3.13.9.4	Damage to the Outer Sheath .....	126
3.13.10	Stripping the Outer Jacket – Tools & Machines .....	127
3.13.10.1	Jacket Stripping with Hand Tools .....	127
3.13.10.2	Manual Bench-top Devices .....	127
3.13.10.3	Semi-Automatic Jacket Stripping .....	128
3.13.10.4	Automatic Cutting and Jacket Stripping.....	128
3.14	Thermal Stripping.....	129
<b>4.</b>	<b>Crimping: Open Barrel Crimp Connectors .....</b>	<b>130</b>
4.1	The Basics .....	130
4.1.1	Terms & Definitions .....	130
4.1.2	Open Crimp Barrels.....	130
4.1.3	Advantages and Disadvantages of Open Crimp Sleeves.....	131
4.1.4	The Wire Crimp of an Open Crimp Sleeve .....	132
4.1.5	Compression Ratio for Open Crimp Sleeves .....	133
4.1.6	What does „Gas-Thightness“ mean?.....	134
4.1.7	Cross-Section Filling – The Effects of Missing Wire Strands .....	135
4.1.8	Soldering Crimp Connections.....	136
4.1.9	Processing Open Crimp Sleeves.....	138
4.1.9.1	Embossings in the Wire Crimp Area.....	138
4.1.9.2	Taped Crimp Contacts.....	138
4.1.9.3	Single Contacts .....	139
4.1.9.4	The Roll Crimp .....	139
4.1.10	Overview of Crimp Shapes .....	142
4.1.11	Assignment.....	143
4.1.11.1	Assignment Crimp Contact – Nominal Cross Section – Tooling .....	143
4.1.11.2	Assignment: Conductor Nominal Cross Section – Crimp Contact .....	144
4.1.11.3	Assignment: Insulation Diameter – Crimp Contact.....	145
4.1.12	Mechanical Play of the Crimped Contact in the Housing.....	146
4.1.12.1	Effects of Lacking Cavity Play.....	147
4.2	Overview of the Crimp Connection Areas .....	148
4.3	Wire and Wire Positions .....	149
4.3.1	The Stripping Length .....	149
4.3.2	Inserting and Positioning the Stripped Wire into the Crimp Contact .....	150
4.3.2.1	Conductor End / Conductor Protrusion.....	150
4.3.2.2	Position of Conductor and Seal in the Crimp Contact .....	150
4.3.2.3	Seal Positions.....	151
4.3.2.4	Wire Insertion: Crimp Applicators.....	151
4.3.2.5	Wire Insertion: Crimp Applicators in Fully Automatic Crimp Machines .....	153

4.3.2.1	Wire Insertion: Hand Crimp Tools .....	154
4.4	The Wire Crimp Area.....	156
4.4.1	Wire Crimp: Creating a Crimp Connection.....	157
4.4.2	Crimp Dimensions .....	158
4.4.2.1	Wire Crimp Height .....	158
4.4.2.2	Tolerances .....	159
4.4.2.3	Wire Crimp Height and Properties of Crimp Connections .....	160
4.4.2.4	The Crimp Height – A Compromise.....	160
4.4.2.5	Crimp Dimensions & Micrograph.....	161
4.4.2.6	Wire Crimp Width .....	162
4.4.3	The Rear Bellmouth.....	163
4.4.3.1	Task & Origin.....	164
4.4.3.2	Wire Crimper & Bellmouth .....	165
4.4.3.3	Size of the Rear Bellmouth .....	165
4.4.3.4	Adjusting the Bellmouth: Sidefeed Crimp Applicator .....	166
4.4.3.5	Adjusting the Bellmouth – Endfeed Crimp Applicator.....	167
4.4.3.6	Bellmouth Formation – Hand Tools .....	168
4.4.3.7	Variations in Bellmouth Size and Execution .....	169
4.4.3.10	Effects of a Missing Rear Bellmouth.....	170
4.4.3.11	Causes for the Lack of a Bellmouth.....	171
4.4.3.12	Effects of an Excessive Rear Bellmouth.....	171
4.4.4	The Front Bellmouth .....	173
4.4.5	Burr Height and Width at the Crimp Base.....	174
4.4.6	Number of Captured Wire Strands and the Stripping Result .....	175
4.4.7	Crimp Flank Design .....	175
4.4.7.1	Crimp Flank Symmetry .....	177
4.4.7.2	Position and Location of the Crimp flank Tips.....	177
4.4.7.3	Material Thickness of the Crimp Contacts Base .....	177
4.4.7.4	Supporting Height.....	177
4.4.7.5	Supporting Angle .....	177
4.4.7.6	Error Description – Curling of the Crimp Flanks.....	178
4.5	The Insulation Crimp .....	184
4.5.1	Insulation crimp Shapes and Requirements .....	184
4.5.1.1	Overview – Insulation Crimp Shapes .....	184
4.5.1.2	Determining the Insulation Crimp Dimensions .....	185
4.5.1.3	Bending Test .....	185
4.5.1.4	Wrapping Test.....	186
4.5.1.5	B/F-Shape Insulation Crimp .....	187
4.5.1.6	B/F-Shape Insulation Crimp: Common Errors.....	187
4.5.1.7	B/F -Shape Insulation Crimp: Special Variant.....	188
4.5.1.8	Overlap Crimp (OV) .....	188

4.5.1.9	Formation of an Overlap Crimp.....	188
4.5.1.10	Overlap Crimp: Common Errors.....	189
4.5.1.11	The Asymmetric O-Crimp .....	190
4.5.1.12	Asymmetric O-Crimp: Common Errors.....	190
4.5.1.13	Asymmetric O-Crimp with Seal .....	191
4.5.1.14	Asymmetric O-Crimp with Seal: Common Error.....	191
4.5.1.15	Symmetric O-Crimp with Seal .....	191
4.5.1.16	Symmetric O-Crimp with Seal: Common Errors.....	191
4.5.1.17	Insulation Crimp: Position Deviation and Contact Geometry .....	192
4.5.1	Positional Deviation (Tilting) of the Insulation Crimp Flanks.....	193
4.6	Single Wire Seal Assembly – Conductor Sealing .....	194
4.6.1	The Seal.....	194
4.6.2	Assignment of the Seal to the Crimp Contact .....	195
4.6.3	Singulation - Feeding of the seal .....	195
4.6.4	Putting Seals on a Wire .....	197
4.6.5	Automatic Control of the Seal Position .....	198
4.6.6	Insulation Crimp Shapes for Seal Processing.....	199
4.6.7	Assembly of Sealed Crimp Contacts .....	199
4.7	Transition or Connection of the Wire Crimp to the Functional Area .....	200
4.8	The Functional Area.....	201
4.8.1	Positive-Locking Connection.....	201
4.8.2	Spring-Loaded Contact Surfaces .....	202
4.8.1	The Contact Area .....	203
4.8.2	The Connector Thickness .....	204
4.8.3	Mating Force – Tensile Force.....	204
4.8.4	Latching Function – Latches .....	205
4.8.5	Damage due to Functional Tests.....	206
4.9	Symmetries in the Crimp Connection.....	207
4.9.1	Symmetry: Position Deviation (Bending) WC/IC .....	207
4.9.2	Position Deviation Contact Area to Crimp Area .....	209
4.9.3	Distortion between Crimp Area and Contact Area.....	210
4.10	The Cut-off Tab – Connection to the Carrier Strip .....	212
4.10.1	Cut-Off Tab Length .....	212
4.10.2	Cut-Off Tab Length in Sealed Contacts.....	212
4.10.3	Setting The Cut-Off Tab length in an Endfeed Applicator.....	212
4.10.4	Cut-Off Tab Length in Sidefeed Applicators.....	213
4.10.5	Error Description: Cut-Off Tab Length .....	214
4.10.5.1	Sidefeed – Rear Cut-Off Tab Too Long.....	214
4.10.5.2	Endfeed – Rear Cut-off Tab Too Long .....	215
4.10.5.3	Sidefeed – Rear Cut-off Tab too Short .....	216
4.10.5.4	Endfeed - Rear Cut-off Tab Too Short.....	217

4.10.5.5 Variations in the Length of the Cut-Off Tabs.....	218
4.10.6 Cut-off Tab – The Burr.....	219
4.11 The „Shark Tooth“ Wire Pin.....	221
4.12 The Multi-Element Clip .....	222
4.12.1 The Multi-Element Clip – Wear Parts .....	223
4.13 The Clip – With or Without Insulation Crimp.....	224
<b>5. Test Method and Application.....</b>	<b>225</b>
5.1 Fundamentals and General Information.....	225
5.1.1 Tests as a Source of Error .....	227
5.1.2 Which Test Detects Which Errors.....	229
5.1.3 When To Perform Which Test? .....	230
5.1.4 In-Production Testing Regarding Processing Equipment.....	231
5.1.5 Special Release – Risk Assessment of A Crimp Connection .....	232
5.2 Visual Inspection.....	233
5.2.1 The Visual Inspection Protocol.....	233
5.2.2 Visual Inspection – Overview .....	234
5.2.3 Visual Inspection - Insulation crimp .....	235
5.3 Measuring Crimp Dimensions.....	236
5.3.1 Wire Crimp Height – Open Crimp Barrel.....	236
5.3.2 Measuring Tools– Open Crimp Barrel.....	236
5.3.3 Measurement Procedure – Open Crimp Barrel.....	238
5.3.4 Wire Crimp Width – Open Crimp Barrel.....	239
5.4 Pull-out Test.....	240
5.4.1 General .....	240
5.4.2 Requirements for a Pull-Out Tester.....	240
5.4.2.1 Pull-Out Tester Types.....	240
5.4.2.2 Receptacle for Crimp Contacts .....	241
5.4.2.3 Clamping Device for the Wire .....	242
5.4.3 Test Preparations .....	243
5.4.4 Pull-Out Test – Procedure.....	243
5.4.5 Visual Evaluation During the Pull-Out Test.....	244
5.4.6 Errors and Interfering Factors During Pull-Out Tests .....	245
5.4.6.1 Closed Insulation Crimp Flanks / Insulation Crimp.....	245
5.4.6.2 Subsequent Opening of the Insulation Crimp Flanks .....	245
5.4.6.3 Holding the Test Specimen by Hand .....	246
5.4.6.4 Crimp Contact Bending in the Receptacle .....	246
5.4.6.5 Jerky, Fast Pull-Out .....	247
5.4.7 Application Examples.....	247
5.4.8 Pull-out Force in Relation to the Wire Crimp Height.....	248
5.4.9 Pull-Out Values Open Crimp Barrel.....	249
5.4.10 Pull-Out Values Crimp Connection.....	249

5.5	Micrograph Preparation.....	250
5.5.1	Principles.....	250
5.5.2	Position of the Microsection .....	252
5.5.3	Separating and Polishing the Crimp Contact .....	252
5.5.4	Cleaning the Microsection.....	253
5.5.5	Measuring the Crimp Geometry .....	253
5.5.6	Errors in Micrograph Evaluation .....	253
5.5.7	Example of a Micrograph Documentation.....	254
5.5.8	The Insides of a Crimp – Open Crimp Barrel.....	256
5.5.9	The Limits of Crimping Technology – Open Crimp Barrel .....	257
5.5.10	Evaluation Criteria for Micrographs .....	258
5.5.11	Micrographs of Faulty Samples.....	259
5.6	Crimp Force Monitoring and the Open Crimp Barrel .....	261
5.6.1	The Philosophy behind it.....	261
5.6.2	Schematic Structure .....	262
5.6.3	The "Piezo-Effect".....	262
5.6.4	The Force Curve.....	263
5.6.5	Forces in Dependence of the Conductor Cross-Section .....	263
5.6.6	Interfering Forces.....	264
5.6.6.1	The Crimping Machine.....	264
5.6.6.2	Tool Holder in the Crimping machine .....	265
5.6.6.3	Tool Base Plate .....	266
5.6.6.4	The Crimp Applicator .....	267
5.6.6.5	The Crimp Contact .....	268
5.6.6.6	The Stripped Wire.....	268
5.6.7	The Learning or Calibration Process (Teach-In) .....	269
5.6.8	Error Detection – Tolerances – Headroom .....	271
5.6.1	Drift of the Force Curve.....	272
5.6.2	Drift Compensation.....	272
5.6.3	What Does Crimp Force Monitoring Detect – The Real World .....	273
5.7	Slow-Motion-Test .....	274
5.7.1	Fundamentals.....	274
5.7.2	The Test.....	275
5.7.3	Required Changes.....	276
5.7.4	Source of Error: Wire Crimper.....	277
5.7.5	Alternative Processing .....	279
<b>6.</b>	<b>Machine Technology.....</b>	<b>280</b>
6.1	Fundamentals .....	280
6.2	Machine Types.....	281
6.3	Structure of a Crimping Machine .....	282
6.3.1	The Bottom Tool Fixture .....	283

6.3.2	The Machine Stroke.....	284
6.3.3	Crimping Machine Standards – Bottom Dead Center .....	284
6.3.4	Adjusting the Bottom Dead Center .....	285
6.3.5	Alternative Setting of the Crimp Height.....	286
6.3.6	Inserting Crimp Tools.....	287
6.3.7	Machine Capability .....	288
6.4	The Stripper-Crimper (Open Crimp Barrel) .....	289
6.4.1	Basics and Philosophy .....	289
6.4.1	Stripper-Crimper: The Functional Units .....	289
6.4.2	Stripper-Crimper: The Work Cycle .....	290
6.4.3	Stripper-Crimper: Function Variants .....	293
6.4.3.1	Variant 1: Stripping Unit in the Working Line .....	294
6.4.3.2	Variant 2: Stripping Unit Outside the Crimp Tool .....	295
6.4.3.3	Variant 2 - Errors .....	297
6.4.4	Stripper-Crimper: Gripper Unit .....	298
6.4.4.1	Errors in the Gripper Unit .....	299
6.4.5	The Stripping Unit.....	300
6.4.5.1	Function of the Sensor in the Stripper-Crimper.....	300
6.4.5.2	Stripping Blades: Requirements.....	301
6.4.5.3	Setting the Stripping Unit .....	302
6.4.5.4	Stripping Blades: Setting OK.....	304
6.4.5.5	Error – Surface of the Wire Strands is Scratched .....	305
6.4.5.6	Stroke Limitation – A Stop for the Wire.....	306
6.4.5.7	Setting Error – Too Much Removal Force for Insulation Residue .....	309
6.4.6	Inserting the Wire.....	310
6.4.6.1	Correct Insertion of the Wire .....	310
6.4.6.2	Error – Wire Bent During Insertion .....	311
6.4.6.3	Error – Wire Inserted at a Wrong Angle.....	312
6.4.7	The Crimp Tool (Applicator) .....	313
6.4.8	Error: Wire is „Hollow“ .....	314
6.4.9	The Zero-Cut .....	315
6.4.9.1	Zero-Cut: Semi or Fully Automatic .....	315
6.4.9.2	Zero-Cut: Manual.....	317
<b>7.</b>	<b>Crimping Tool Technology (Applicator) – Open Crimp Barrel.....</b>	<b>318</b>
7.1	Overview.....	318
7.1.1	Tool Types.....	318
7.1.2	Crimp Applicator: Definitions.....	319
7.1.3	Achivable, Reproducible Quality .....	320
7.1.4	Effects of Tool Settings - Example: Contact Position .....	321
7.2	Basic Structure of Crimp Applicators .....	324
7.2.1	References in the Sidefeed Crimp Applicator .....	325

7.2.2	References in the Endfeed Crimp Applicator .....	327
7.3	Crimper, Anvil, Shear Unit .....	327
7.3.1	Assignment of the Wear Parts.....	327
7.3.1	Wire Crimper and Insulation Crimper .....	328
7.3.1.1	The „Lean“ Crimper .....	329
7.3.2	The Anvil .....	330
7.3.3	The Shear Units.....	331
7.3.3.1	Shear Unit for Sidefeed Crimp Applicators .....	331
7.3.3.2	Shear Unit for Endfeed Crimp Applicators .....	332
7.4	Setting the Crimp Height .....	334
7.4.1	Overview of Tool Heads.....	334
7.4.2	Sliding Head .....	334
7.4.3	Rotating Disk with Several Fixed Crimp Heights.....	335
7.4.4	Rotating Disk with Stepless Adjustment .....	335
7.4.5	The Ram and its most important Components.....	336
7.4.6	Setting the Crimp Heights – The Principle .....	337
7.5	The Feed of the Crimp Contact .....	338
7.5.1	Feed Variants – Feed Curve .....	338
7.5.2	The Principle of Mechanical Feed .....	339
7.5.3	Pneumatic Feed .....	345
7.6	Wire Stop – The Wiper as a Positioning Aid.....	347
7.7	Sensor Triggering as a Positioning Aid .....	348
7.8	The Wiper .....	349
7.9	Hold-Down Systems.....	351
7.9.1	Function and Area of Application.....	351
7.9.2	Hold-Down Systems for Sidefeed and Endfeed Applicators .....	352
7.9.3	Hold-Downs for Sidefeed Applicators .....	353
7.10	Endfeed Applicator: Settings .....	354
7.10.1	The Feed – Positioning the Crimp Contact .....	354
7.10.2	Feed: Setting Rear and Front Bellmouth .....	355
7.10.3	The Feed: Setting Front and Rear Cutoff Tabs .....	356
7.10.4	The Feed: Incorrect Contact Position .....	359
7.10.4.1	Crimp Contact is Not Transported Far Enough.....	359
7.10.4.2	Crimp Contact Transported too Far.....	360
7.10.4.3	Position Deviation (Tilting) of the Insulation Crimp Flanks .....	361
7.10.5	The Feed – Stroke Length .....	362
7.10.6	The Contact Brake.....	364
7.10.7	Contact Guide in the Endfeed Applicator.....	365
7.10.1	Shear Unit for Separating Crimp Contacts.....	367
7.10.1.1	Composition of the Shear Unit .....	367
7.10.1.2	Setting Error – Shear Unit.....	368

7.10.1.3	Burr Formation on the Cutoff tabs .....	368
7.10.2	Feed Finger .....	369
7.11	Sidefeed Applicator: Settings.....	370
7.11.1	The Feed: Positioning the Crimp Contact.....	371
7.11.2	The Feed: Incorrect Contact position.....	372
7.11.3	The Feed – Stroke Length .....	372
7.11.4	The Contact Brake.....	373
7.11.5	Contact Guide & Tool Table.....	374
7.11.5.1	Contact Play in the Contact Guide .....	374
7.11.5.2	Contact Play: Incorrect Setting.....	374
7.11.5.3	Setting the Contact Position.....	375
7.11.6	The Feed Finger .....	377
7.11.7	The Shear Unit .....	378
7.11.7.1	Structure and Function of a Shear Unit .....	379
7.11.7.2	Incorrect Settings.....	380
7.12	Crimp Tool Maintenance .....	380
7.12.1	Wear & Tear in the Crimping Tool (Applicator) .....	380
7.12.2	Functional Areas in the Wire Crimper.....	380
7.12.2.1	Mechanical Stress on the Wire Crimper .....	382
7.12.2.2	Wear on the Insulation Crimper.....	383
7.12.2.3	Wear on the Anvil .....	384
7.12.2.4	Wear on the Shear Units.....	385
7.12.3	Replacing Wear Parts.....	386
7.12.3.1	When is the Wear Part Change carried out? .....	386
7.12.3.2	The „Set-Up Crimping Machine“ .....	387
7.12.3.3	Changing Wear Parts: Step by Step.....	388
7.12.3.4	Replacing Wear Parts – Wire Crimper & Insulation Crimper .....	389
7.12.3.5	Replacing Wear Parts - Sidefeed Shear Unit.....	390
7.12.3.6	Replacing Wear Parts - Endfeed Shear Unit .....	392
7.12.4	Example for a Maintenance Plan.....	393
7.12.5	Visual Inspection of Wear Parts .....	394
7.12.5.1	Wire Crimp & Insulation Crimp .....	394
7.12.5.2	The Anvil .....	395
7.12.5.3	Shear Unit .....	395
7.12.6	Visual Inspection of the Crimp Tool.....	396
7.12.7	Crimp Tool Storage.....	396
<b>8.</b>	<b>Hand Tools in Cable Processing – Cutting &amp; Stripping .....</b>	<b>397</b>
8.1	Important Information on Working with Hand Tools.....	397
8.2	Cutting Cabels and Wires.....	397
8.2.1	The Cable Shear .....	398
8.2.2	Comparison: Cable Shear vs. Side Cutter .....	399

8.3	Jacketing with Hand Tools.....	400
8.3.1	Jacketing Sheathed Cables .....	400
8.3.1.1	General .....	400
8.3.2	Structure of Multi-Core Sheathed Cables .....	400
8.3.3	Error Descriptions .....	401
8.3.4	Hand Tools for Jacket Stripping .....	402
8.4	Stripping with Hand Tools.....	403
8.4.1	Basic Principles of Stripping.....	403
8.4.2	Stripping Result Requirements.....	404
8.4.3	Spripping Blades – Types of Wire Strippers .....	404
8.4.4	Wire Stripper with Straight Blades.....	405
8.4.5	Stripping Tool with V-Shaped Blades .....	406
8.4.6	Stripping Tool with Radius Baldes.....	406
8.4.7	Error Descriptions for Hand Strippers.....	408
8.4.7.1	Overview .....	408
8.4.7.2	Damaged and/or Cut Wire Strands .....	409
8.4.7.3	Pulled Wire Strand.....	409
8.4.7.4	Scratched Wire Strand Surface.....	410
8.4.7.5	Improperly Cut Insulation .....	410
8.4.7.6	Insulation Threads on the Insulation Cutting Edge.....	411
8.4.7.7	Insulation Damaged.....	412
8.4.7.8	Insulation Parts on the Wire Strands .....	413
8.4.7.9	Twisting of the Wire Strands Undone .....	413
8.4.7.10	Broom-Shaped Conductor End .....	413
8.4.7.11	Bent Wire Strand(s) .....	414
8.4.7.12	Overtwisted Conductuo Strands .....	415
8.5	Work Instruction for Stripping with Hand Tools.....	416
8.5.1	Standard Wire Strippers.....	416
8.5.2	Hand Stripping Tools with Radius Blades.....	417
8.5.3	Checking the Stripping Results: .....	417
<b>9.</b>	<b>Hand Crimp Tools: Processing Open Barrel Contacts.....</b>	<b>418</b>
9.1	Introduction and Fundamentals .....	418
9.2	Attainable, Repeatable Quality .....	421
9.3	Checklist for a Good Crimp Connection.....	422
9.4	Requirements for Hand Crimp Tools.....	422
9.5	Hand Crimp Tool – Types.....	423
9.6	Hand Crimp Tools – Types and Differences.....	424
9.7	Overview of the Composition of Hand Crimp Tools.....	425
9.8	The Positioning Aid (Locator) .....	426
9.9	Wear & Mechanical Force –The Adjuster Wheel.....	426
9.10	The Crimping Die Set - Assignments .....	427

9.11	Emergency Release Function – Opening the Hand Crimp Tool.....	431
9.12	Handling of Hand Crimp Tools.....	431
9.13	The Table Mount.....	432
9.14	Preparing the Crimp Contact.....	435
9.14.1	Cutoff Tabs.....	436
9.14.2	Separating Crimp Contacts - Tools .....	436
9.15	Working with Hand Crimp Tools – Open Crimp Barrell.....	437
9.15.1	Positioning Crimp Contacts – Insertion Depth .....	437
9.15.2	Positioning the Crimp Contact – Position between the Crimp Dies.....	440
9.15.3	Inserting the Stripped Wire.....	442
9.15.4	Positioning the Stripped Wire in the Crimp Contact .....	443
9.16	Crimp Result Evaluation.....	444
9.17	An Overview of the Most Common Errors.....	445
9.18	Poor Crimping Result - What To Do?.....	446
9.19	Cut Off and Start all Over! .....	447
9.20	Calibration - Inspection – Maintenance.....	448
9.20.1	Hand Tool Calibration .....	448
9.20.2	Hand Crimp Tool Maintenance.....	448
9.20.3	Inspection of Hand Crimp Tools .....	448
9.20.4	Checking The Positioning Aid (Locator).....	449
9.20.5	Crimp Quality Check: .....	449
9.21	Work Instructions: Creating a Crimp Connection.....	450
9.21.1	Determining the Stripping Length.....	450
9.21.2	Standard Stripping Pliers .....	450
9.21.3	Hand Stripper with Radius Blades.....	451
9.21.4	Check Stripping Result .....	451
9.21.5	Hand Crimp Tools for Open Barrel Contacts .....	452
9.21.6	Approval & Quality Check .....	452
9.21.7	Producing a Crimp Connection .....	452
9.21.7.1	Separating Crimp Contacts .....	452
9.21.7.2	Hand Crimp Tools with Locator .....	453
9.21.7.3	Hand Crimp Tools without Locator .....	453
9.21.7.4	Visual Inspection .....	454
<b>10.</b>	<b>Closed Crimp Barrels .....</b>	<b>455</b>
10.1	Types and Crimp Shapes .....	455
<b>11.</b>	<b>Wire End Ferrules .....</b>	<b>457</b>
11.1	Basics .....	457
11.2	Wire End Ferrule Types .....	459
11.3	Crimp Shapes .....	460
11.4	Plastic Collar Insulation – With or Without .....	461
11.5	Structure of Wire End Ferrules .....	461
11.6	Conductor Protrusion .....	462

11.7 Stripping Length.....	462
11.8 Assignment.....	462
11.9 Requirement on the Crimp .....	463
11.10 Processing Wire End Ferrules .....	464
11.11 Creating A Crimp with Ferrules.....	465
11.12 Creating a Ferrule Crimp with Hand Tools .....	465
11.12.1 Determining the Stripping Length.....	465
11.12.2 Setting the Stripping Length on the Pliers.....	466
11.12.3 Creating a Crimp Connection with a Ferrule.....	466
11.13 Visual Inspection & Error Descriptions.....	467
11.14 Hidden Errors.....	467
11.15 Installation of Wires with Ferrules .....	469
11.16 The Micrograph.....	469
11.17 The Pull-Out Test.....	470
11.18 Pull-Out Values for Wire End Ferrules .....	471
11.19 Ferrule Color Codes (example: Germany) .....	471
<b>12.Turned Contacts – 4/8-Indent Crimp .....</b>	<b>472</b>
12.1 General.....	472
12.2 Contact Shape .....	472
12.3 Structure and Geometry .....	473
12.4 Requirements on the Contact Material.....	473
12.5 Processing Turned Contacts .....	474
12.6 Hand Crimp Tools .....	475
12.7 Wear in Crimping Tools.....	475
12.8 Positioning Aid – Locator.....	477
12.9 The Indenters.....	477
12.10 Positioning and Crimping.....	478
12.11 Micrographs of a Crimping Process.....	479
12.12 Error Descriptions .....	480
12.12.1 Deformed Crimp Contact BEFORE Crimping .....	480
12.12.2 Deformed Crimp Contact AFTER Crimping .....	480
12.12.3 Hidden Errors .....	481
12.12.4 Broken Wire Strands.....	481
12.12.5 Micrographs.....	482
12.13 Creating a Crimp Connection: Turned Crimp Contacts.....	483
12.13.1 Preparation before Crimping: Wire Stripping .....	483
12.13.2 Important check before starting work:.....	483
12.13.3 Preparation for Crimping: Adjusting The Hand Crimping Tool.....	485
12.13.4 Creating a Crimp Connection .....	486
12.13.1 Visual Inspection of the Crimp Connection .....	487
<b>13.Insulated Cable Lugs .....</b>	<b>488</b>
13.1 Processing Methods.....	488

13.2	Hand Crimp Tools and Die Sets .....	488
13.3	Crimp Applicators.....	488
13.4	Compression via the Insulation Sleeve .....	489
13.5	Error: Stress Whitening .....	490
13.6	Contact Assignment – Color Code.....	490
13.7	Structure of Insulated Cable Lugs.....	491
13.7.1	Standard Version – Without Insulation Fixation .....	491
13.7.2	Insulated Cable Lugs with Insulation Fixation.....	492
13.1	Requirements for the Crimp Connection .....	494
13.2	Position in the Crimp Tool .....	495
13.3	Multiple Crimp .....	496
13.4	Compensating Cross-Section Differences .....	496
13.5	Testing Insulated Cable Lugs .....	497
13.5.1	Insulation Fixation.....	497
13.5.2	Pull-Out Test .....	498
13.5.3	Visual Inspection .....	498
13.5.4	Micrograph Verification .....	499
13.5.5	Overview: Errors when Processing Insulated Cable Lugs .....	500
13.6	Insulated Butt Connector.....	500
<b>14.</b>	<b>Closed Crimp Barrels .....</b>	<b>501</b>
14.1	Contact Variants and Crimp Shapes.....	501
14.2	Quality Requirements – The Micrograph.....	502
14.1	Compression Lug – Tubular Lug – Solderless Terminal.....	503
14.1.1	Tubular Lugs for Special Applications .....	504
14.1.2	Contact Material for Cable Lugs .....	504
14.1.3	Classification of Conductors.....	504
14.2	Hexagonal Crimp Shape .....	505
14.2.1	Crimp Contact Types .....	506
14.2.1.1	Compression Cable Lug .....	506
14.2.1.2	Butt Connectors.....	506
14.2.2	Hexagonal Crimping of CU & AL - Terminals (Cable Lugs).....	507
14.2.3	Number of Crimps.....	508
14.2.4	Crimping Sequence .....	508
14.2.5	Overveiw: Faulty Crimps.....	509
14.2.6	Creating a Crimp Connection.....	510
14.2.7	Measuring a Hexagonal Crimp.....	512
14.3	Indent Crimp Shape .....	513
14.3.1	Solderless Terminals .....	513
14.3.2	Creating an Indent Crimp .....	515
14.4	Deep Indent Crimp – Aluminum Connectors.....	516
14.4.1	General Information .....	516

14.4.2 Schematic Structure .....	516
14.4.3 Single and Double Indent Crimp .....	517
14.5 Other Crimp Shapes .....	518
14.5.1 The Dual System.....	518
14.5.2 Notch Crimp Shape .....	519
<b>15. Splice technology .....</b>	<b>520</b>
15.1 General Information .....	520
15.2 The Splice Machine.....	520
15.3 Setup of a Splice Machine.....	521
15.4 The Spliceband .....	521
15.5 Processing of Solid & Enamelled Wires.....	522
15.6 Assignments & Combinations.....	523
15.6.1 Stranded Conductor with Stranded Conductor .....	523
15.6.2 Stranded Conductor with Solid Conductor.....	523
15.6.3 Solid Conductor with Solid Conductor .....	524
15.7 The Basic Procedure – Creating A Splice Connection .....	525
15.8 Positioning in the Splice Connection.....	528
15.8.1 Insertion error .....	529
15.9 Measuring & Testing .....	530
15.9.1 Testing as a Source of Error .....	530
15.9.2 Visual Inspection of Splice Connections.....	530
15.9.3 Creating and Evaluating a Micrograph .....	531
15.9.4 Determining the Micrograph Level in the Splice Connection .....	531
15.9.5 Crimp Flanks Rolling In.....	532
15.9.6 Measuring Crimp Dimensions .....	533
15.9.7 The Pull-Out Test.....	534
15.9.8 Visual Evaluation of the Test Specimen .....	535
15.9.9 Pull-Out Values for Splice Connections.....	535
15.9.10 Crimp Force Monitoring .....	535
15.10 Typical Applications .....	536
<b>16. Assembly – Disassembly of Crimp Contacts .....</b>	<b>537</b>
16.1 Installing Wires.....	537
16.2 The Connector Housing .....	538
16.3 Latching Function – Latches.....	540
16.4 Cavity Play.....	541
16.5 The Crimp Contact in the Connector Housing.....	542
16.6 Connector Assembly .....	543
16.7 Checking the Assembly.....	546
16.8 Connector Assembly on Fully Automatic Units.....	547
16.9 Dissasembly of Crimp Contact and Housing .....	548
<b>17. Crimping Technology – Procedural Information .....</b>	<b>552</b>
17.1 Foreword & Notes .....	552

17.2 Task & Initial Positions .....	553
17.3 Which Requirements for Which Application? .....	553
17.4 Fundamentals: Test Methods .....	554
17.4.1 Measuring Crimp Dimensions .....	554
17.4.2 Micrograph Preparation .....	555
17.4.2.1 Position of the Cutting Section .....	555
17.4.2.2 Cutting, Polishing & Cleaning .....	555
17.4.3 Pull-Out Test .....	555
17.4.4 Crimp Force Monitoring .....	556
17.4.4.1 The Learning Process (Teach-In) .....	557
17.4.4.2 Checking the Crimp Force Monitoring System .....	557
17.5 The Conductor Material .....	558
17.6 Processing of Conductor Materials .....	558
17.7 Stripping Result .....	559
17.8 Test Protocol – The Open Crimp Barrel .....	560
17.8.1 Designations – Definitions .....	560
17.8.2 The Open Crimp Barrel (Without Seal) .....	561
17.8.3 Note: The following evaluations are examples and do not claim to be complete. Depending on the type of application or area of use of the crimp connection, non-compliance with the specifications may result in further effects or other consequences! .....	561
17.8.3.1 Additional specifications when using single conductor seals .....	566
17.8.4 Insulation Crimp .....	567
17.8.5 Insulation Crimp with Seal .....	567
17.8.6 Insulation Crimp without Seal .....	568
17.8.7 Mechanical Play of the Crimped Contact in the Housing .....	569
17.8.7.1 Effects of Lacking Cavity Play .....	570
17.8.8 Micrograph Report – Wire Crimp .....	571
17.8.9 Additions And Examples for Micrograph Evaluation .....	573
17.8.9.1 Principles for the Curling of the Crimp Flanks .....	573
17.8.9.2 Filling Cross-Section – Allocation Error (Cavities) .....	573
17.8.9.3 Small Crimp Contacts .....	574
17.8.9.4 Specifications in Product Catalogues and Data Sheets: .....	574
17.8.9.5 Burr Formation in the Crimp Contact & Crimp Base Thickness .....	574
17.9 Qualification of Crimp Connections .....	576
17.9.1 Data Collection .....	576
17.9.2 Creating Sample Crimps .....	577
17.9.3 Check .....	577
17.9.4 Evaluation .....	577
17.9.4.1 Crimp Connection OK .....	577
17.9.4.2 Crimp Connection NOK .....	577
17.10 Release of Production Equipment .....	578
17.10.1 Responsibilities .....	578

17.10.2 The Crimp Machine .....	578
17.10.3 The Crimp Tool.....	579
17.10.4 The Hand Crimp Tool.....	579
17.10.5 Manufacturing Processes.....	580
17.10.6 Documentation of the Release.....	580
<b>17.11 Inspections during Production .....</b>	<b>581</b>
17.11.1 Depending on the Processing Equipment.....	581
17.11.2 Depending on Tasks in Production.....	582
17.11.3 Test Intervals.....	583
17.11.4 Accompanying Documents (for Product Delivery).....	583
17.11.4.1 Test Report .....	583
17.11.4.2 Micrograph Report.....	583
17.11.4.3 Other Documents .....	583
<b>17.12 Other Types of Crimp Contacts .....</b>	<b>584</b>
17.12.1 Turned Contacts .....	584
17.12.1.1 Micrograph: Creation & Evaluation.....	584
17.12.1.2 Visual Inspection of the Crimp Connection .....	584
17.12.2 Wire Ferrule.....	585
17.12.2.1 Visual Inspection .....	585
17.12.2.2 Installation Advice.....	585
<b>18. Getting Grip on Crimp Quality – How to Start? .....</b>	<b>587</b>
18.1 Introduction.....	587
18.2 Fundamentals .....	588
18.3 Crimp Specifications .....	588
18.4 The Data Sheet.....	589
18.5 Data Collection.....	589
18.5.1 Crimp Contact.....	589
18.5.2 Data Collection Wire .....	590
18.6 The Crimp Tool .....	590
18.6.1 The Crimp Tool: A First Check.....	590
18.7 Sample Crimp and Visual Inspection .....	591
18.8 Visual Inspection Report .....	592
18.9 Sample crimp – Determining Measuring Results.....	592
18.10 Interim Result and Correction.....	593
18.11 The Micrograph.....	593
18.12 Evaluation and Archiving.....	594
18.13 Crimp Connection is Not OK! Now What?.....	594
<b>19. Annex .....</b>	<b>596</b>
19.1 Electrical Basics of Crimping Technology .....	596
19.2 Specific Electrical resistance .....	596
19.3 Specific Electrical Resistance and Conductivity .....	596
19.4 Conductor Resistance .....	596

19.5 Temperature Dependence of the Resistance .....	597
19.6 Temperature Coefficients of Materials at 20 °C.....	597
19.7 Contact Resistance – Transition Resistance.....	598
<b>20. Alternative Processing Technologies .....</b>	<b>599</b>
20.1 Tinning – Tip Tinning.....	599
20.1.1 Principles.....	599
20.1.2 Stripping and Twisting (Strip & Twist).....	599
20.1.2.1 Manual Twisting.....	600
20.1.2.2 Automatic Twisting on Machines.....	600
20.1.3 The Flux-Station .....	601
20.1.4 Tinning Stations.....	601
20.1.5 Full Tinning – Tip Tinning.....	603
20.1.5.1 Full Tinning.....	603
20.1.5.2 Tip Tinning .....	603
20.1.6 Errors during Tinning .....	604
20.2 Ultrasound in Cable Assembly.....	605
20.2.1 General .....	605
20.2.2 Application Examples.....	606
20.2.3 The Sound.....	607
20.2.4 Sound Waves .....	608
20.2.5 Sound Velocity (The Speed of Sound) .....	609
20.2.6 The Piezo Effect .....	610
20.2.7 Definitions Ultrasonic Welding.....	611
20.2.7.1 The Welding Unit.....	611
20.2.7.2 Generator.....	612
20.2.7.3 The Converter .....	612
20.2.7.4 The Booster.....	613
20.2.7.5 The Sonotrode.....	613
20.2.8 Quality Features .....	613
20.2.8.1 Quality of the Conductor (Wire Strands) .....	613
20.2.8.2 Wire Strand Diameter .....	613
20.2.8.3 Material Hardness .....	614
20.2.8.4 The Surface.....	614
20.2.8.5 The Alloy .....	614
20.2.9 Weldable Materials .....	615
20.2.10 Tools .....	616
20.2.11 Tool Surface Design .....	616
20.2.12 Influence on Energy Penetration .....	617
20.2.13 Tool Materials .....	617
20.2.14 Influences on Tool Life Times .....	617
20.2.15 Influence on the Frequency.....	618

20.2.16 The Gap Dimension.....	619
20.2.17 The Principle of a Wire Node .....	619
20.2.18 Stripping .....	620
20.2.19 Wire Stripping Length .....	621
20.2.20 Work Procedure Ultrasonic Welding of Wire Nodes.....	621
20.2.21 Quality Requirements .....	622
20.2.21.1 Requirements for a Good Welding Connection.....	622
20.2.21.2 Electrical Properties.....	623
20.2.21.3 Mechanical Load .....	623
20.2.21.4 The Gas Tight Connection: Chemical Resistance.....	623
20.2.21.5 Burrs .....	623
20.2.21.6 Insulation.....	624
20.2.22 Testing .....	624
20.2.22.1 Visual Inspection .....	624
20.2.22.2 Pull-Out Test .....	625
20.2.22.3 Peel Test.....	625
20.2.22.4 Micrograph .....	626
20.2.22.5 Lab Tests .....	626
20.2.23 Automatic Quality Control .....	627
20.2.24 Detecting Faulty Welds .....	628
20.2.25 Degree of Compression .....	630
<b>21.Index.....</b>	<b>670</b>